


## ADVANCE PLUS FLUE SWEEP

### AFTER SERIAL NUMBER ENDING 1116

**ENSURE THAT YOU HAVE NO DEMAND WHILST DOING SWEEP MODE**

1. Open at least one hot water tap fully
2. Press and hold down **A, B, C**, together
2. Goes to **PR 01**
3. Press **A + C** together should go to **LP**

If necessary remove the centre nut from the gas valve using a 4 mm alun key  
clockwise to increase anti clockwise to decrease

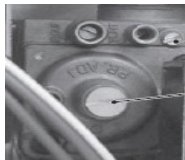

4. Press **A** 2 times to go to **DP** check high CO2  
*Please note will go to **CP** before **DP***
5. When finished hold button **B** for 2 Seconds should go to small **00**
6. Turn Mains **OFF** and **BACK** on again will go to **00** Turn boiler on.

